


HP CP3520, HP CP 3525 and HP CM 3530™

Investigation by Delacamp has shown that there are two different versions of the CE25x cartridges. There are small differences in the toner hopper and one end cap which mean that the two types are not interchangeable. (see photo 1, 2 and 3) Mixing of these components leads to problems in assembly. If not noticed the misalignment will lead to very high load on the printer drive motor, causing the printer to stop.


1. Picture

This picture shows the old style OEM hopper.

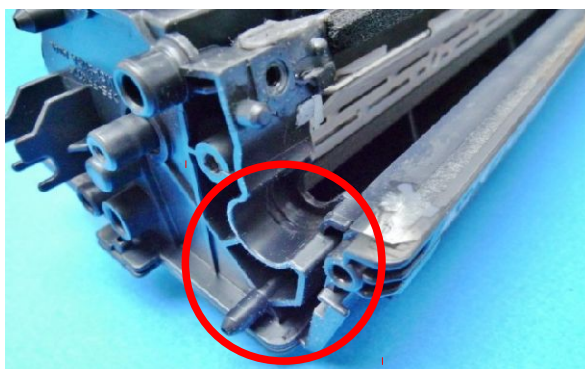

2. Picture

This picture shows the new style OEM hopper.

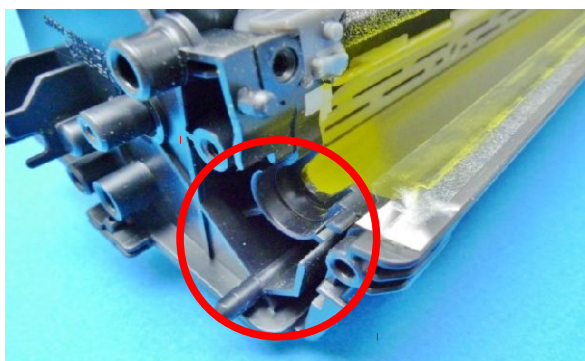

3. Picture

This picture shows the different versions of contact side inner end cap. (left old style, right new style)

